

Final Random Inspection Report

Client Ref. No.:60064 | Report No.:60589 | Date:May6.06 | Page: of

EXECUTIVE SUMMARY AND INSPECTION STANDARD:

Client:	xxxxxx	Contact person:	
PO.No.:	060427-1	E-mail:	xxxxxxxxxx
Description:	Ladies jersey set composed with short sleeves +T-shirt+ long skirt	Fax No.:	xxxxxxxxxx
Supplier:	Shenzhen	Contact person:	
Insp. Location:	Shenzhen, China	Tel No.:	86-755-
Time of insp.:	1 st <input checked="" type="checkbox"/> 2 nd <input type="checkbox"/> 3 rd <input type="checkbox"/>	Fax No.:	86-755-

Item No.	Ordered Qty	Packed Qty	Unpacked Qty	Actual Qty	Remark		
260196	2000 sets	2000 sets	0	2000 sets			
Inspection standard: ANSI/ASQC Z1.4-1993				Sample Size: 125 pcs			
Sampling plan: <i>Single, Normal</i>				Critical	Major	Minor	
Inspection level: II							
AQL: Critical: Not Allowed.				AQL:	0	2.5	4.0
				Defects Found:	0	4	12
				Max. Allowed:	0	7	16

RESULT SUMMARY AND CONCLUSION:

Inspection criteria	Result	Comments
Quantity available:	[<input checked="" type="checkbox"/>] conformed [<input type="checkbox"/>] not conformed	
Workmanship:	[<input type="checkbox"/>] conformed [<input checked="" type="checkbox"/>] not conformed	Out of AQL standard!
Test:	[<input checked="" type="checkbox"/>] conformed [<input type="checkbox"/>] not conformed	
Data measurement:	[<input checked="" type="checkbox"/>] conformed [<input type="checkbox"/>] not conformed	
Labeling:	[<input checked="" type="checkbox"/>] conformed [<input type="checkbox"/>] not conformed	
Packing:	[<input checked="" type="checkbox"/>] conformed [<input type="checkbox"/>] not conformed	
Shipping mark:	[<input checked="" type="checkbox"/>] conformed [<input type="checkbox"/>] not conformed	
Overall Conclusion:	[<input type="checkbox"/>] Acceptable [<input checked="" type="checkbox"/>] Reject [<input type="checkbox"/>] Pending	

Remark:

Final Random Inspection Report

Client Ref. No.:60064 | Report No.:60589 | Date:May6.06 | Page: of

Factory representative's signature and company chop: _____ Date: _____

Inspector's Name: _____ Inspection time: from _____ to _____ Date: _____

INSPECTION RESULT IN DETAILED:

WORKMANSHIP:

No.	Defects Description	Critical	Major	Minor	
1	The length of skirt out of tolerance		1		
2	Insecure sewn label		3		
3	Wrong folded main label			4	
4	Untrimmed thread end			4	
5	Puckering at side seam			3	
6	Dirty stain			5	
7					
8					
9					
10					
11					
12					
13					
14					
15					
16					
17					
18					
		Total defect:	0	4	16
		Allowed:	0	5	10
		Result:	Reject		

TEST AND MEASUREMENT:

Test items	Sample size	Result	Comments
Product dimension:	S-3: 13 sets	[<input checked="" type="checkbox"/>] conformed [<input type="checkbox"/>]not conformed	Refer to measure report.
Materials:	S-1:	[<input checked="" type="checkbox"/>] conformed [<input type="checkbox"/>]not conformed	Same as approval sample
Carton drop test:	S-1: 2ctns	[<input checked="" type="checkbox"/>] conformed [<input type="checkbox"/>]not conformed	30 inch, OK!
Power on test:	S-2:	[<input type="checkbox"/>] conformed [<input type="checkbox"/>]not conformed	N/A

Final Random Inspection Report

Client Ref. No.:60064 | Report No.:60589 | Date:May6.06 | Page: of

Battery test:	L- II :	[] conformed []not conformed	N/A
Print adhesive check	S-2:8 sets	[✓] conformed []not conformed	OK!
Internal check:	S-1:	[] conformed []not conformed	N/A
Zipper pulling check	S-3:13 sets	[✓] conformed []not conformed	OK!
Thickness of poly bag	S-2:8 sets	[✓] conformed []not conformed	50 micros as PO required

LABEL CHECKING:

Label	Result	Comments
(Small part) warning label:	[] conformed []not conformed	N/A
Price label:	[] conformed []not conformed	N/A
“Made in china”:	[✓] conformed []not conformed	Print on export carton.
Barcode label:	[✓] conformed []not conformed	376010267964Printed On Export Carton.
UL / CE / customer Logo.	[✓] conformed []not conformed	Customer Mark Printed On Export Carton.
Customer label:	[] conformed []not conformed	N/A
	[] conformed []not conformed	
	[] conformed []not conformed	

PACKING AND ACCESSORIES:

1). Shipping Mark:

Main Mark: (___ sides)	Side Mark: (___ sides)	Top Mark/Inner mark
N/A	N/A	<u>N/A</u>

2). Packaging Method And Accessories:

1. Each sets in a poly bag, 20 sets (solid packing) in a big poly bag.
2. 100 sets in a master carton.

3). Export Carton Dimension:

Actual Measure: (L) 42 × (W) 39 × (H) 40 cm
Actual G.W: 21.6 Kg s

REMARKS:


Final Random Inspection Report

Client Ref. No.:60064







Report No.:60589

Date:May6.06

Page: of




PRODUCT AND DEFECTS PHOTO SHOW:

	
<p style="text-align: center;">1. packing method</p>	<p style="text-align: center;">2. packing method</p>
	
<p style="text-align: center;">3. unit in poly bag</p>	<p style="text-align: center;">4. unit (one set)</p>
	
<p style="text-align: center;">5. T-shirt</p>	<p style="text-align: center;">6. Y/D design short skirt</p>

Final Random Inspection Report

Client Ref. No.:60064 | Report No.:60589 | Date:May6.06 | Page: of

	
<p>7. plain beige long skirt</p>	<p>8. printing on the front side of poly bag</p>
	
<p>9. printing on back side of poly bag</p>	<p>10. printed label stuck in the right bottom corner (remark3)</p>
	
<p>11. side slits at bottom</p>	<p>12. thickness of poly bag checking test</p>
	
<p>13. weight of one set checking</p>	<p>14. major defect :insecure sewn label</p>


Final Random Inspection Report

Client Ref. No.:60064

Report No.:60589

Date:May6.06


Page: of

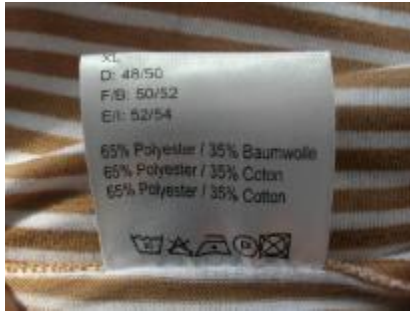

15. printing on label (back side)



16. printing adhesive checking

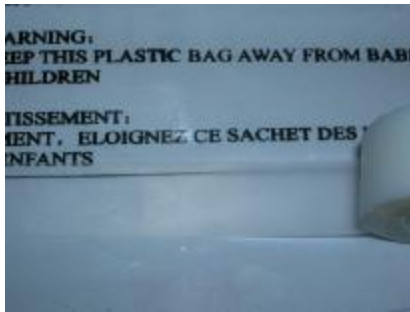

17. printing adhesive checking (no peel off)



18. minor defect : untrimmed thread end